

TEST REPORT

No. : CZIN2303000025CM

Date: Mar 20, 2023

Page: 1 of 7

CUSTOMER NAME: CHANG ZHOU HUAREN DECORATIVE MATERIAL CO., LTD
ADDRESS: NO.110 CHANGHONG ROAD, WUJIN DISTRICT, CHANGZHOU CITY,
JIANGSU

Sample Name : SPC FLOORING
Spec. : 1524*227.5*7mm

Above information and sample(s) was/were submitted and confirmed by the client. SGS, however, assumes no responsibility to verify the accuracy, adequacy and completeness of the sample information provided by client.

Test Required : Please see the next page(s)
SGS Ref. No. SHIN2303000489CM
Ref. Standard : Please see the next page(s)
Date of Receipt : Mar 06, 2023
Testing Start Date : Mar 06, 2023
Testing End Date : Mar 17, 2023
Test result(s) : For further details, please refer to the following page(s)
(Unless otherwise stated the results shown in this test report refer only to the sample(s) tested)

Signed for
SGS-CSTC Standards Technical
Service (Changzhou)Co., Ltd.

Tiffany Liu
Authorized signatory



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.
Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

TEST REPORT

No. : CZIN2303000025CM

Date: Mar 20, 2023


Page: 2 of 7

Summary of Results:

No.	Test Item	Test Method	Result	Conclusion
1	Impact Sound Insulation	EN ISO 10140-3:2021	See Result	/
2	Impact Sound Improvement	EN ISO 10140-1:2021 Annex H	See Result	/

Note: Pass: Meet the requirements;
Fail: Does not meet the requirements;
/: Not Apply to the judgment.

Original Sample Photo(s):

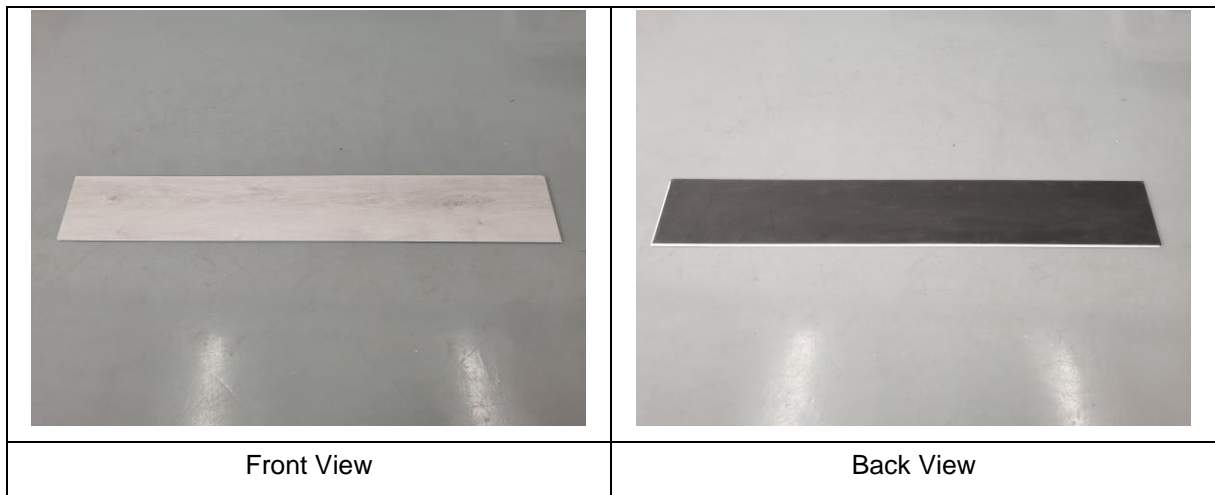

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.
Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Technical Services (Changzhou) Co., Ltd.
Commercial Consistency Technical Services

No.3, Hehai East Road, Tianning District, Changzhou, China 213021
中国·常州·天宁区河海东路3号 邮编:213021

t (86-519) 8876 9607 www.sgs.com.cn
t (86-519) 8876 9607 sgs.china@sgs.com

Member of the SGS Group (SGS SA)

TEST REPORT

No. : CZIN2303000025CM

Date: Mar 20, 2023

Page: 3 of 7

1. Test Item: Impact Sound Insulation

I. Test Method

EN ISO 10140-3:2021 Acoustics - Laboratory measurement of sound insulation of building elements - Part 3: Measurement of impact sound insulation

II. Sample Details

Dimensions	1524mm×227.5mm×7mm
Surface Density	About 10.61kg/m ²

III. Test Condition

Ambient Temperature	15.5°C	Relative Humidity	57.9%RH
Source Room Volume	70m ³	Receiving Room Volume	85m ³
Description of Test Arrangement	Test Area: 11.80m ² (3.87m×3.05m) The test sample is laid directly on the 140mm thick prefabricated floor.		



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.
Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC (常州) 技术服务有限公司
Commercial Consulting Technical Services (Changzhou) Co., Ltd.

No.3, Hehai East Road, Tianning District, Changzhou, China 213021
中国·常州·天宁区河海东路3号 邮编:213021

t (86-519) 8876 9607 www.sgs.com.cn
t (86-519) 8876 9607 sgs.china@sgs.com

Member of the SGS Group (SGS SA)

TEST REPORT


No. : CZIN2303000025CM

Date: Mar 20, 2023

Page: 4 of 7

IV. Test Result

f Hz	L _n dB
100	61.1
125	67.3
160	67.1
200	69.1
250	68.0
315	67.8
400	66.8
500	63.4
630	59.6
800	58.3
1000	53.1
1250	47.4
1600	43.4
2000	40.5
2500	34.3
3150	28.9
4000	23.8
5000	/

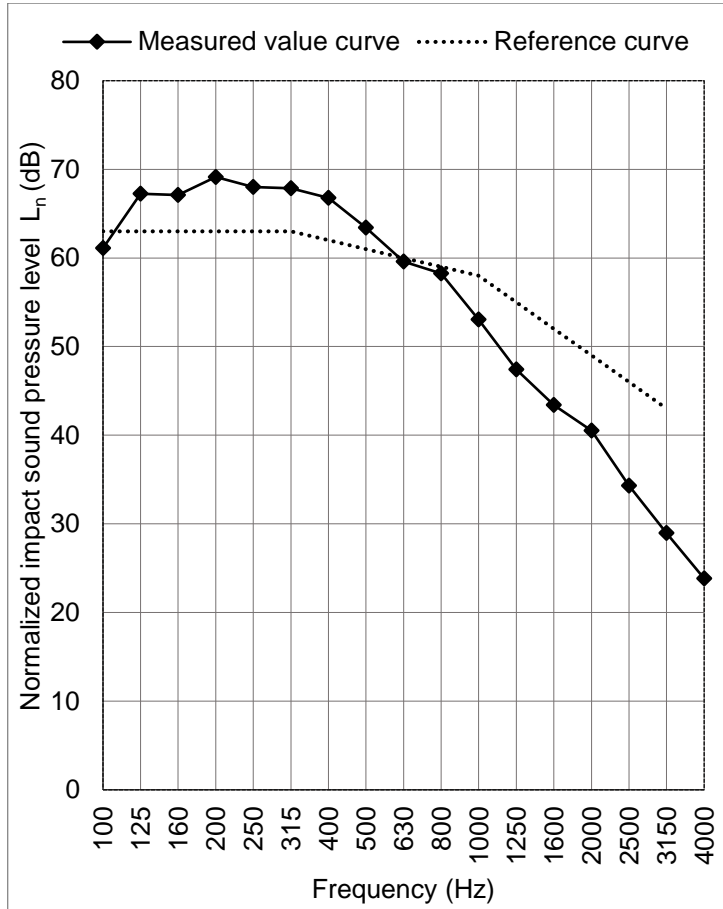

V. Weighted Normalized Impact Sound Pressure Level

Rating according to EN ISO 717-2:2020:

L_{n,w} = 61dB, C_i = 0dB

Note: L_{n,w} is the weighted normalized impact sound pressure level, based on the test performed with an artificial source under laboratory conditions (engineering method) with the specified reference floor.

C_i is the spectrum adaptation term for L_{n,w}, the corresponding spectrum correction should be added.



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.
Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Technical Services (Changzhou) Co., Ltd.
Commercial Consulting & Technical Services

No.3, Hehai East Road, Tianning District, Changzhou, China 213021
中国·常州·天宁区河海东路3号 邮编:213021

t (86-519) 8876 9607 www.sgs.com.cn
t (86-519) 8876 9607 sgs.china@sgs.com

TEST REPORT

No. : CZIN2303000025CM

Date: Mar 20, 2023

Page: 5 of 7

2. Test Item: Impact Sound Improvement

I. Test Method

EN ISO 10140-1:2021 Acoustics - Laboratory measurement of sound insulation of building elements - Part 1: Application rules for specific products, Annex H

II. Sample Details

Dimensions	1524mm×227.5mm×7mm
Surface density	About 10.61kg/m ²

III. Test Condition

Ambient temperature	15.5°C	Relative humidity	57.9%RH
The source room Volume	70m ³	The receiving room Volume	85m ³
Description of test arrangement	Test Area: 11.80m ² (3.87m×3.05m) The test sample is laid directly on the 140mm thick prefabricated floor.		



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Documents.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.
Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Technical Services (Changzhou) Co., Ltd.
Commercial Consistency Technical Services

No.3, Hehai East Road, Tianning District, Changzhou, China 213021
中国·常州·天宁区河海东路3号 邮编:213021

t (86-519) 8876 9607 www.sgs.com.cn
t (86-519) 8876 9607 sgs.china@sgs.com

Member of the SGS Group (SGS SA)

TEST REPORT


No. : CZIN2303000025CM

Date: Mar 20, 2023

Page: 6 of 7

IV. Test Result

f Hz	$L_{n,r,0}$ dB	$L_{n,r}$ dB	ΔL dB
100	67.0	66.8	0.2
125	67.5	67.5	0.0
160	68.0	66.6	1.4
200	68.5	67.1	1.4
250	69.0	66.5	2.5
315	69.5	66.4	3.1
400	70.0	65.4	4.6
500	70.5	63.6	6.9
630	71.0	60.4	10.6
800	71.5	58.1	13.4
1000	72.0	53.2	18.8
1250	72.0	47.7	24.3
1600	72.0	43.6	28.4
2000	72.0	40.4	31.6
2500	72.0	34.7	37.3
3150	72.0	29.3	42.7
4000	72.0	24.8	47.2
5000	/	/	/

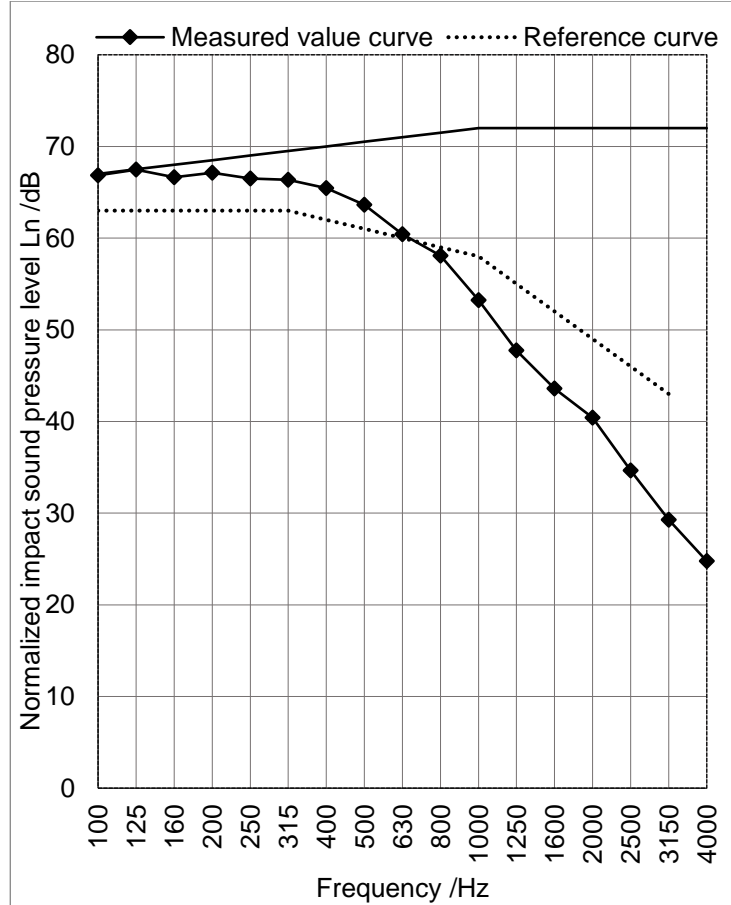

Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.
Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Technical Services (Changzhou) Co., Ltd.
Commercial Consulting Technical Services

No.3, Hehai East Road, Tianning District, Changzhou, China 213021
中国·常州·天宁区河海东路3号 邮编:213021

t (86-519) 8876 9607 www.sgs.com.cn
t (86-519) 8876 9607 sgs.china@sgs.com

TEST REPORT

No. : CZIN2303000025CM

Date: Mar 20, 2023

Page: 7 of 7

V. Weighted Reduction of Impact Sound Pressure Level

Rating according to EN ISO 717-2:2020:

$L_{n,r,w} = 61\text{dB}$, $\Delta L_w = 17\text{dB}$, $C_{i,r} = 0\text{dB}$, $C_{i,\Delta} = -11\text{dB}$

Note: $L_{n,r,w}$ is the weighted normalized impact sound pressure level, ΔL_w is the weighted reduction impact sound pressure level, based on the test performed with an artificial source under laboratory conditions (engineering method) with the specified reference floor.

$C_{i,r}$ is the spectrum adaptation term for $L_{n,r,w}$, $C_{i,\Delta}$ is the spectrum adaptation term for ΔL_w . In the case of the actual sound source impact, the corresponding spectrum correction should be added.

Note: This declaration of conformity is only based on the result of this laboratory activity, the impact of the uncertainty of the results was not included.

***** End of report*****



Unless otherwise agreed in writing, this document is issued by the Company subject to its General Conditions of Service printed overleaf, available on request or accessible at <http://www.sgs.com/en/Terms-and-Conditions.aspx> and, for electronic format documents, subject to Terms and Conditions for Electronic Documents at <http://www.sgs.com/en/Terms-and-Conditions/Terms-e-Document.aspx>. Attention is drawn to the limitation of liability, indemnification and jurisdiction issues defined therein. Any holder of this document is advised that information contained hereon reflects the Company's findings at the time of its intervention only and within the limits of Client's instructions, if any. The Company's sole responsibility is to its Client and this document does not exonerate parties to a transaction from exercising all their rights and obligations under the transaction documents. This document cannot be reproduced except in full, without prior written approval of the Company. Any unauthorized alteration, forgery or falsification of the content or appearance of this document is unlawful and offenders may be prosecuted to the fullest extent of the law. Unless otherwise stated the results shown in this test report refer only to the sample(s) tested and such sample(s) are retained for 30 days only.
Attention: To check the authenticity of testing / inspection report & certificate, please contact us at telephone: (86-755) 8307 1443, or email: CN.Doccheck@sgs.com

SGS-CSTC Technical Services (Changzhou) Co., Ltd.
Commercial Consistency Technical Services

No.3, Hehai East Road, Tianning District, Changzhou, China 213021
中国·常州·天宁区河海东路3号 邮编:213021

t (86-519) 8876 9607 www.sgs.com.cn
t (86-519) 8876 9607 sgs.china@sgs.com

Member of the SGS Group (SGS SA)